

## Laser Welding Amodel® PPA Resins

Laser welding has become a popular method of joining plastics in a wide variety of applications. This process offers a number of attractive features including:

- speed and efficiency,
- cleanliness, no debris as with vibration or ultrasonic welding,
- no consumables, such as adhesives,
- no vibration that can damage sensitive components,
- high bond strength,
- hermetic seal can be achieved,
- laser equipment can be used for multiple applications.

Most Amodel® polyphthalamide (PPA) natural and black grades are suitable for laser welding. Laser transmissive colors are also available as special requests.


### The Laser Welding Process

Laser welding typically joins two materials that differ in their response to laser radiation. One material is essentially transparent to the laser (the transmissive material) and the other absorbs the energy and melts (the absorbing material). Welding occurs when the laser energy causes the temperature of the absorbing component to increase to its melting point. Heat is transferred to the transmitting component by conduction and when it melts, the laser energy is removed and the material cools forming a strong joint. Figure 1 presents an illustration of the process.

The laser energy penetrates the upper layer and is absorbed by the lower material (A). The molten material transfers heat to the upper layer (B). A molten pool forms from both layers (C). The pool solidifies when it cools to form a high strength weld (D).

Figure 1

### Laser Welding Process

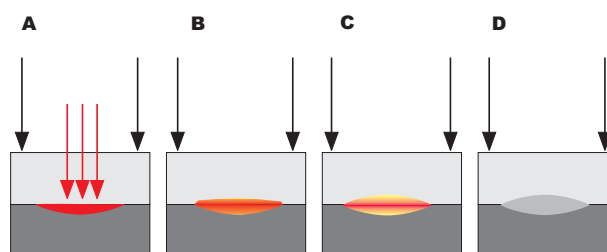

### Lasers

Several types of lasers which can be used to weld plastic components. Nd:YAG lasers have the purest light and are typically the most powerful but are also the most expensive. Diode lasers are more common and less expensive. Since the light from CO<sub>2</sub> lasers is readily absorbed by most plastics, these lasers are not used for transmissive laser welding. CO<sub>2</sub> lasers may be used only for welding very thin films. Table 1 list the properties of the common lasers.

Fiber Lasers are also under development, which offer improvements in energy efficiency, however are relatively high in cost.

### Material Requirements

There are specific requirements for both the absorbing and transmitting materials to be used in a transmissive laser welding application. Ideally, the base polymer comprising each component would be the same, but chemically compatible polymers with similar melt points can also be used. For example, Amodel AS-1133 HS NT can be welded to Amodel AS-4133 HS BK324.

### Transmissive Material Requirements

The transmissive component allows the laser energy to pass through it to heat the absorbing component below. Therefore the transmissive component must be relatively transparent to

Table 1

**Laser Types and Properties**

Laser Type	CO <sub>2</sub>	Nd:YAG	Diode
Wavelength, nm	10,600	1,064	800 - 1,000
Maximum. power, W	60,000	6,000	6,000
Efficiency	10%	3%	30%
Beam Transmission	Reflection off mirrors	Fiber optic and mirrors	Fiber optic and mirrors
Minimum spot size, mm	0.2-0.7 diameter	0.1-0.5 diameter.	0.5 x 0.5
Interaction with Plastics	Complete absorption at surface in <0.5 mm	Transmission and bulk heating for 0.1-10 mm	Transmission and bulk heating for 0.1-10 mm

laser energy at the wavelength of the laser being used. The transmissive layer will remain relatively cool while the absorbing component heats. Typically, at least 30% of the laser energy needs to be transmitted to the absorbing component. The presence of additives, fillers, and pigments can significantly alter the transmissivity of the polymer and proper selection of materials is critical.


The thickness of the transmissive component is also a factor, since the transmissivity is also thickness dependent. This requires design consideration when structural components are to be welded. The typical thickness of

transmissive components is 1.6 to 0.8 mm (0.062 to 0.031"). However, this dimension is only required in the area to be welded. Other sections of the part as well as the width of the weld path can be modified to provide for overall part structural requirements. Table 2 lists some common Amodel resins and the maximum recommended thickness at which the natural color can be used as the transmissive component.

**Absorber Requirements**

The absorbing component is the part which melts and transfers heat to the transmitting part creating the weld.

Figure 2

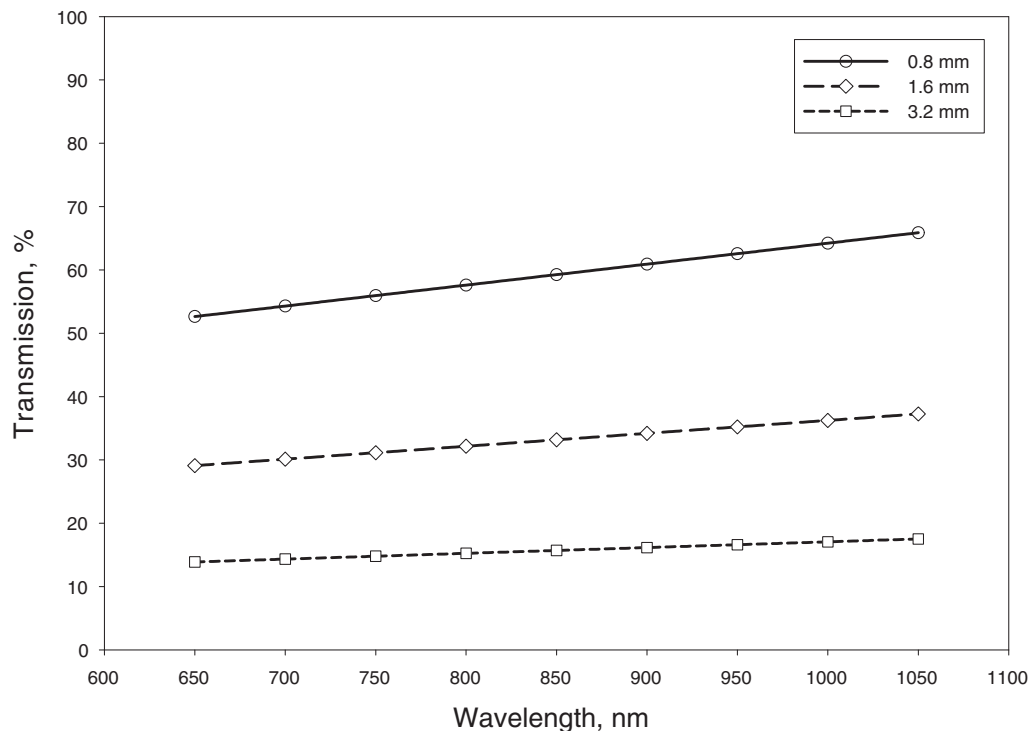**Typical Transmissivity of Natural Amodel Resin**

**Table 2**  
**Maximum Thickness for Use in Transmissive Role**

Amodel Grade	mm	inches
A-1133 HS NT	1.6	0.063
A-1145 HS NT	1.4	0.055
A-1240 L NT	NR*	NR*
A-6135 NL NT	2.1	0.083
AS-1133 HS NT	1.9	0.075
AS-1566 HS NT	0.9	0.035
AS-4133 HS NT	1.1	0.043
AS-4133 L NT	1.4	0.055
AT-1002 HS NT	NR*	NR*
AT-1116 HS NT	2.1	0.083
AT-1125 HS NT	1.6	0.063
AT-5001 NT	1.5	0.059
ET-1000 HS NT	1.7	0.066
ET-1001 L NT	0.8	0.031

\*not recommended

Therefore, the absorbing component contains additives — typically carbon black — that efficiently absorb the laser energy. The amount of the carbon black present is critical, as too much or little can result in inferior performance. When working with Amodel resins, most grades with a color code of BK324 or BK543 are suitable for the absorber.


If using a different polymer that the transmitting component, the melting point of the absorber must be equal to or slightly higher than the melting point of the transmitting component. When attempting to weld different polymers, there must be some compatibility between the two resins.

### Weld Strength

Very good weld strengths can be achieved using laser welding. However, since reinforcing agents such as fiberglass do not typically bridge the weld, the actual strength of the weld would be approximately equal to the strength of the unfilled polymer.

Figure 3

**Transmissivity of Amodel A-6135 BK275**

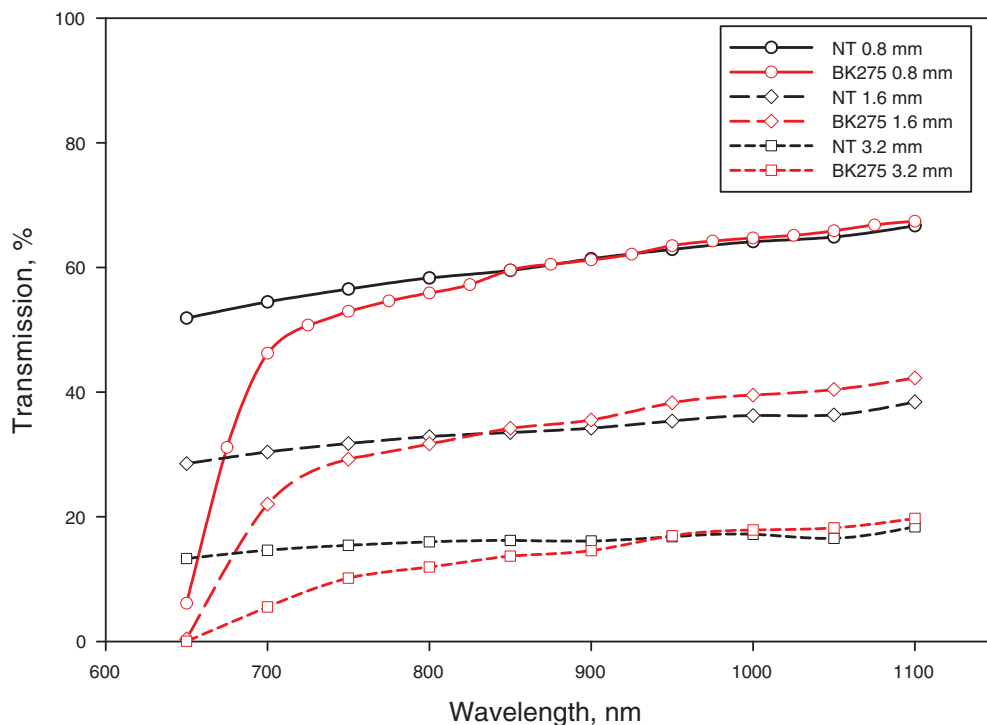

## Laser Welding Colors

As has been noted above, most laser welding applications will utilize a natural, or unpigmented polymer as the transmitter and a black polymer as the absorber. Certain application aesthetics may require that both components be the same color. This can create problems, as pigments are typically laser absorbers and would interfere with the transmissivity requirements. Solvay Advanced Polymers has developed color systems which are transmissive at the laser light wavelengths yet are absorbers in the visible spectrum, meaning that the parts may be colored as desired. Similarly, there are laser absorbing pigments which can be utilized to impart a color other than black to the absorbing component.

Amodel A-6135 BK275 has been developed especially for use in laser welding. Figure 3 shows that this grade which appears black has the transmissivity of natural material at laser wavelengths.

## Conclusion

Laser welding has become a popular and useful method of joining plastic components. Solvay Advanced Polymers has developed grades of Amodel PPA specifically for laser welding, both in natural and colors.

For more information, contact your Solvay Advanced Polymers representative.

---

### Solvay Advanced Polymers, L.L.C.

4500 McGinnis Ferry Road

Alpharetta, Georgia 30005-3914 USA

Phone: +1.770.772.8200

+1.800.621.4557 (USA Only)

Fax: +1.770.772.8454

Please visit our website at [www.solvayadvancedpolymers.com](http://www.solvayadvancedpolymers.com) to locate the office nearest you.

### Health and Safety Information

Material Safety Data Sheets (MSDS) for our products are available upon request from your Solvay Advanced Polymers sales representative or by writing to the address shown above. Always consult the appropriate MSDS before using any of our products.

---

Amodel is a registered trademark of Solvay Advanced Polymers, L.L.C.

To our actual knowledge, the information contained herein is accurate as of the date of this document. However, neither Solvay Advanced Polymers, LLC nor any of its affiliates makes any warranty, express or implied, including merchantability or fitness for use, or accepts any liability in connection with this information or its use. This information is for use by technically skilled persons at their own discretion and risk and does not relate to the use of this product in combination with any other substance or any other process. This is not a license under any patent or other proprietary right. The user alone must finally determine suitability of any information or material for any contemplated use, the manner of use and whether any patents are infringed. This information gives typical properties only and is not to be used for specification purposes. Solvay Advanced Polymers, LLC reserves the right to make additions, deletions, or modifications to the information at any time without prior notification.